Laser Distance Meter

D100

User Manual



REGISTER YOUR PRODUCT

www.uniks.it

The registration of your products will allow you to stay informed about news, take advantage of advantageous
discounts dedicated to you for the purchase of accessories and products for your daily work.

Registration is free

1. Safety Regulations..... 4
2. Display / Button..... 5
3. Batteries Installation..... 6
4. Start the Instrument / Menu Setting 7
5. Self-Calibration 9
6. Single Measurement..... 10
7. Continuous Measurement 10
8. Area Measurement 11
9. Volume Measurement 12
12. Addition / Subtraction 15
13. Record Function 17
14. Specifiche Tecniche 19
15. Instrument Maintenance..... 20
16. Packing List 21
17. ASSISTANCE..... 22



1. Safety Regulations

Please read the safety regulations and operation guide carefully before operating.

⚠ Please read all of the operational guide and safety regulations in this manual before operation . Improper operations without complying with this manual may cause damage to the device, influence on measurement result or cause personal injury to the user or a third party.

⚠ The instrument is not allowed to disassemble or repair in any ways. It is forbidden to do any illegal modification or performance change for the laser emitter. Please keep it out of reach of children and avoid being used by any irrelevant person.

⚠ It is strictly prohibited to shoot eyes or other parts of body with the laser. It is not allowed to take the laser to shoot the surface of any highly reflective objects.


⚠ Due to electromagnetic radiation interference to other equipment and devices, please don't use the meter in the plane or around medical equipment, don’t use it in inflammable, explosive environment.

⚠ Discarded batteries or meter device should not be processed just like household garbage, please handle them in line with related law and regulations.

⚠ Any quality issues or any questions on the meter, please contact local distributors or manufacturer in time, we are ready to offer solutions for you.


2. Display / Button

- **Display**
  - Power Supply
  - Record
  - Length, Area, Volume and Pythagorean
  - Laser on
  - Maximum Value
  - Auxiliary Display
  - Minimum Value
  - Major Display
- **Button**
  - Turn on/Measuring
  - Addition & Subtration/Save
  - Sound/Area/Volume/ Pythagorean Mode
  - Reference Point/ Unit Switch
  - Turn off/Remove

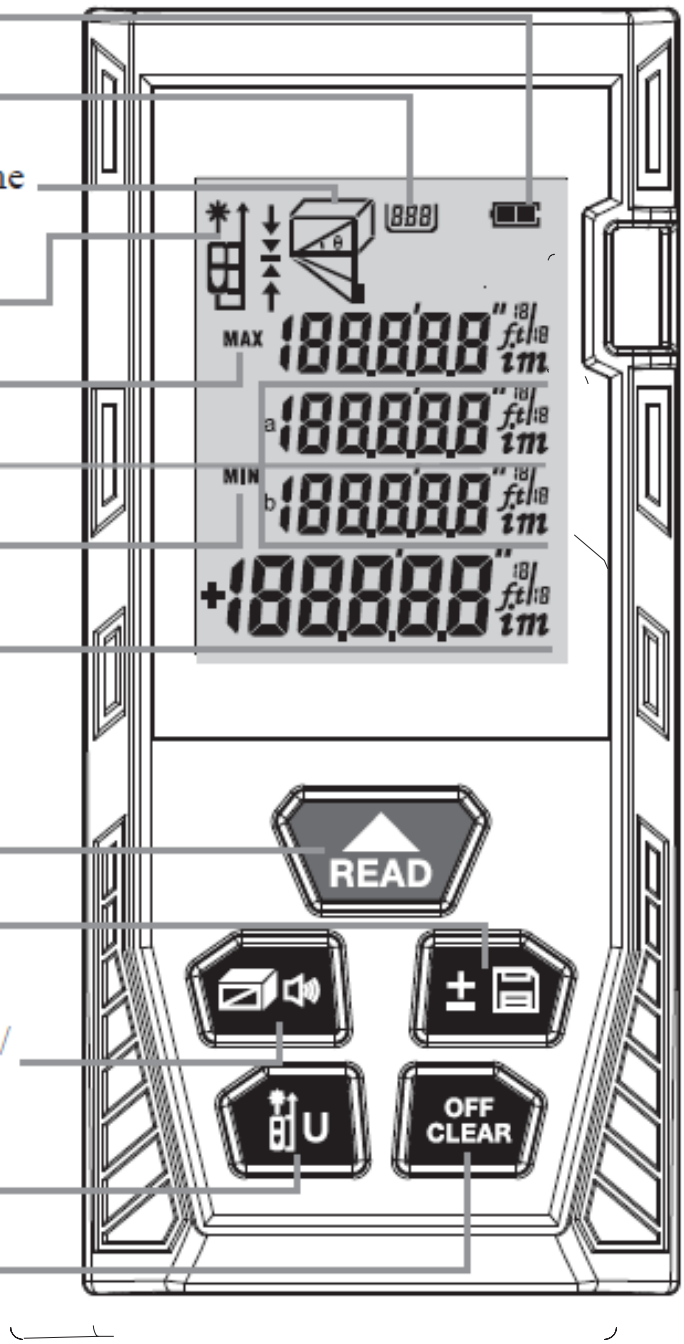

3. Batteries Installation

Battery Installation and Replacement

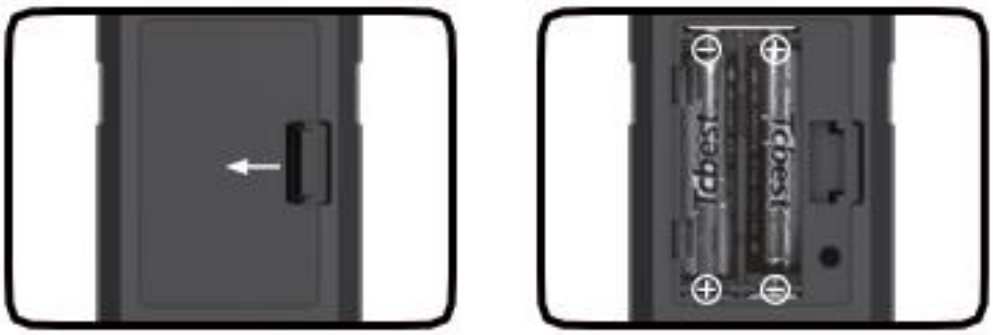

- Open the battery door on the back of device, and place batteries according to correct polarity, then close the battery door.
- 1.5 V AAA battery is applied to the meter.
- If not used for a long time, please take out the batteries to avoid battery corrosion to meter body.

4. Start the Instrument / Menu Setting

Turn On/Off the Instrument

Under off state, press READ, device and laser get started simultaneously and the device enters the measurement mode. Under on state, long press for OFF CLEAR 3 seconds to turn the device off. The device can also be shut off without any operation within 150 seconds.

Unit Setting

Long press U, reset current measurement unit, the default unit is: 0.000m. There are 6 units for selection.

Measurement units:

	Length	Area	Volume
1	0.000m	0.000 m^2	0.000 m^3
2	0.00m	0.00 m^2	0.00 m^3
3	0.0 in	0.00 ft^2	0.00 ft^3
4	0 1/16 in	0.00 ft^2	0.00 ft^3
5	0'00" 1/16	0.00 ft^2	0.00 ft^3
6	0.00 ft	0.00 ft^2	0.00 ft^3

Changing Reference Point

Short press  to change the reference point.

The default reference point is the terminal baseline

Backlight on/off

The backlight is set to turn on and off automatically. The backlight will be on for 15 seconds if any key is pressed. The backlight will automatically turn off if there is no operation within 15 seconds to save power.

Keys Sound

Long press  to turn on or off the sound

5. Self-Calibration

Self-calibration function is provided to ensure the precision of the device.

First, make sure the device is power off, long press OFF CLEAR then press READ to start the device. Next, loose READ when "CAL" and a twinkling figure show at the display. Then the device enters self-calibration mode. At this time, the user can adjust the figure by  and according to

the error of the instrument.

The adjustment range is -9~9mm. Finally, long press READ to save the setting.

For example,

the actual distance is 3.780m.

If the measured value is 3.778m, 2mm smaller than the actual value, the calibration value can be adjusted up by 2mm on the existing basis with  through the calibration function.

If the measured value is 3.783m, 3mm larger than the actual value, the calibration value can be lowered by 3mm on the existing basis with  through the calibration function.

After the adjustment, press READ to save the calibration result .

6. Single Measurement

Under the test mode, press READ, and the instrument emits laser to lock the measuring point. Press READ again for single distance measurement, and the measurement result will be displayed in the major display area.

7. Continuous Measurement

Under the test mode, long press READ to enter the continuous measurement mode, and the maximum and minimum measured values measured in the continuous measurement process will display in the auxiliary display area.

The current measurement value will display in the main display area. Short press READ or OFF CLEAR to exit the continuous measurement mode.

8. Area Measurement

Press ,  shows at the screen. One of the side of rectangle blinks at the display, please follow the below instructions for area measurement:

- Press  once for length
- Press  again for width

The device automatically calculates the area and shows the result in the major display area. The measuring results of the length and width of the rectangle will be showed in the auxiliary display area.

- Press  , clear off the result and measure again if necessary.
- Press  again to exit the mode

9. Volume Measurement

Press  twice to enter volume measurement mode.

A  will show at the top of the screen. Please follow the below instruction for volume measurement:


- Press  for length
- Press  again for width
- Press  thirdly for height

The device automatically calculates the volume and shows the result in the major display area. The measuring results of the length, width and height of the cube will be showed in the auxiliary display area.

Press  , clear off the result and measure again if necessary.


Press  again to exit the mode

10. Pythagoras

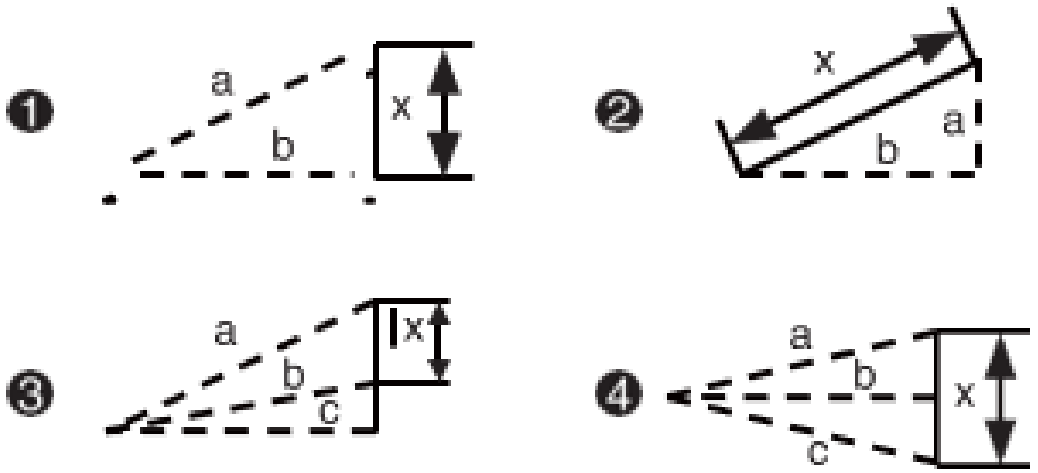


There are four Pythagoras modes which is convenient for indirect measurement in a specific complex environment

1. Calculate the second leg by measuring the hypotenuse and another leg.

Short press  three times to enter Pythagoras mode, the hypotenuse of  blinking.

- Press , measure the length of hypotenuse (a)
- Press , measure the length of one leg (b) Device automatically calculates the length of another leg (x)

2. Calculate the hypotenuse by measuring the length of two legs.

Short press  four times, when one leg of  is blinking.

- Press  , measure the length of one leg (a)
- Press  , measure the length of another leg (b)

Device automatically calculates the length of hypotenuse (x)

3. Press five times till the one side of  blinking on the screen

- Press , measure the length of one side (a)
- Press , measure the length of the median line (b)
- Press , measure the length of another side (c)

Device calculates the length of the leg in full line (x)

3. Press six times till the hypotenuse of blinking on the screen

- Press READ , measure the length of one hypotenuse (a)
- Press READ , measure the length of one leg (b)
- Press READ , measure the length of another hypotenuse(c)

Device calculates the length of the leg in full line (x)

Legs must be shorter than hypotenuse, or there will be "err" showed at screen. In order to guarantee the accuracy, please make sure all measurements are started from the same point and in the order of hypotenuse and legs

12. Addition / Subtraction


The device can be used for the addition and subtraction of single measurement distance. After obtaining the result of a single measurement, enter the selection of addition/ subtraction function through .

Short press , when "+" shows in the major display area, the device enters addition mode. The screen displays the sum of the last measured value and the current measured value


Short press ±, when "-" shows in the major display area, the device enters subtraction mode. The screen displays the difference between the last measured value and the current measured value.

Not only length can be caculated by addition and subtraction, but also area and volume. Take area as an example:


Measure the first area and the result is shown in PIC1. Then press ± to measure the second area and the result is shown in PIC2, and "+" will appear in the lower left corner of the screen. Finally, press READ to get the sum of two areas, as shown in PIC3

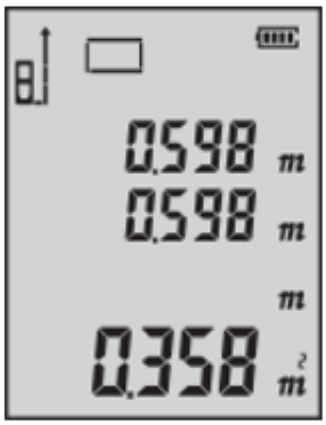

PIC.1

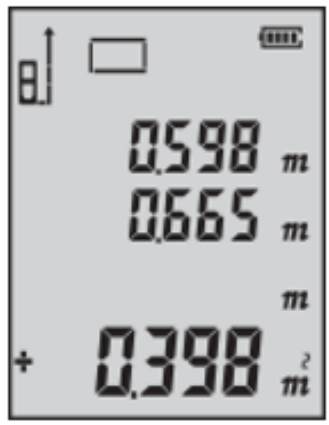

PIC.2

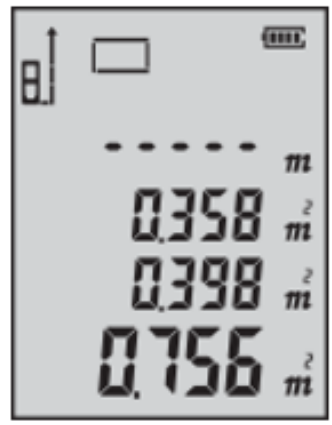

PIC.3

13. Record Function

In measurement mode, if the current data is valid, it will be automatically stored in memory, and the record number  at the top of the screen will continue to accumulate.

Browse / Delete the Records

Long press  to browse the stored measurement data, use  to scroll backward for record, use  to scroll forward for record. While browsing records, long press  to clear all records. Short press  or  to exit the mode.

Tips

During use, the following prompts may be displayed in the major display area:

Prompt	Cause	Solution
Err	Out of the measurement range	Use the device within the measurement range.
Err1	Signal is too weak	Choose the surface with stronger reflection. Use the reflecting plate.
Err2	Signal is too strong	Choose the surface with weaker reflection.
Err3	Low battery voltage	Replace batteries.
Err4	Beyond working temperature	Use the device in the specified temperature.
Err5	Pythagoras measuring breaks the rules	Re-measure and ensure that hypotenuse is longer than legs.

14. Specifiche Tecniche

ARTICOLO	D100
Working Range	0,05-100 m
Precision	± (2 mm + D * 1 / 10000)*
Continuous Measurement	√
Area/Volume Measurement	√
Pythagorean Measurement	√
Add and Subtract Measurement	√
Area &Volume Addition/Subtraction	√
Min/Max Value	√
Self-Calibration	√
Laser Level	II.
Laser Type	630-670 nm, <1 mW
Max Storage	99 units
Automatically Cut off Laser	20s (single measurement)
Auto Power-off	150s
Battery Life	4000 / 8000 times (carbon-zinc battery / alkaline battery)
Voice Prompt	√
Storage Temperature	-20°C~60°C
Working Temperature	0°C~40°C
Storage Humidity	20%~80%RH
Battery	2x1,5 V AAA
Dimension	108x50x25mm

* "d" indicates the actual distance.
** In harsh environment, such as: sunlight is too strong, the ambient temperature fluctuates excessively, the reflection effect of the object's surface is weak, the battery is low, the measurement results will have a large error, so a reflecting plate is needed.

15. Instrument Maintenance

- The meter should not be stored in high temperature and humid environment for a long time. If it is not used very often, please take out the battery and place the meter in the portable bag and store it in cool and dry place.

- Please keep the device surface clean. Use a soft wet cloth to wipe the dust on the surface. Do not use corrosive liquid to clean the device. Use the same method as wiping optical devices to wipe the meter and focusing mirror.

16. Packing List

Please check if all accessories are complete according to the following list.

No.	Item	Unit	QTY
1	Meter	pc	1
2	User Manual	pc	1
3	Gift Box	pc	1
4	Hand Strap	pc	1

17. ASSISTANCE

WARRANTY CONDITIONS

This instrument is warranted against defects in materials and workmanship, in accordance with the general terms and conditions. During the warranty period, defective parts can be replaced, but the manufacturer reserves the right to repair or replace the product. If the instrument is to be returned to the after - sales service or to a dealer transportation is borne by the customer. The shipment must, however, be agreed. Attached to dispatch an explanatory note about the reasons of the instrument must always be inserted. For shipping only use the original packaging. Any damage caused by the use of non-original packing shall be charged to the customer. The manufacturer accepts no responsibility for damage caused to people or objects.

The warranty does not apply in the following cases:

- Repair and / or replacement of accessories and battery (not covered by warranty).
- Repairs made necessary because of a misuse of the instrument or of its use with no compatible devices.
- Repairs made necessary due to improper packaging.
- Repairs made necessary due to work carried out by unauthorized personnel.
- Modification of the instrument without the explicit permission of the manufacturer.
- Use not provided for in the specifications of the instrument or in the instruction manual.

The content of this manual may not be reproduced in any form without the permission of the manufacturer. Our products are patented and their trademarks.
The manufacturer reserves the right to change specifications and prices if this is due to technological improvements.

ASSISTANCE

If the instrument does not operate properly, before contacting the Customer Service, check the status of the battery and wear of the cables and replace them if necessary. If the instrument continues to manifest malfunctions check if the procedure of use of the same is in accordance with what is indicated in this manual. If the instrument is to be returned to the after - sales service or to a 30 dealer transportation is borne by the customer. The shipment must, however, be agreed. Attached to dispatch an explanatory note about the reasons of the instrument must always be inserted. For shipping only use the original packaging; any damage caused by the use of non-original packing shall be charged to the customer.

http://www.uniks.it
info@uniks.it

Uniks Srl
Via Vittori 57
48018 Faenza (RA), Italy
0546.623002
0546.623691